### **GENERAL NOTES**

- ASBESTOS-CONTAINING MATERIALS ARE PRESENT IN ACCESSIBLE AND INACCESSIBLE INTERSTITIAL SPACES THROUGHOUT THIS
- MATERIALS CONTAINING <1% ASBESTOS ARE PRESENT THROUGHOUT THE BUILDING. SEE HAZARDOUS MATERIALS SURVEY AND SPECIFICATION 02 82 21 FOR ADDITIONAL
- ALL CONTRACTORS PERFORMING DEMOLITION ACTIVITIES ARE TO COMPLY WITH ALL APPLICABLE LEAD PAINT REGULATIONS IN OAR 437-DIVISION 3, 1926.62 AND SECTION 02 83 19 OF THE SPECIFICATIONS.
- 4. CONTRACTOR IS TO COORDINATE ALL ABATEMENT ACTIVITIES WITH CONSTRUCTION MANAGER/GENERAL CONTRACTOR INCLUDING BUT NOT LIMITED TO: SCHEDULING, PHASING, ACCESS, AND SECURITY, POWER AND WATER NEEDS, PROTECT AND SAVE ITEMS, LOCKOUT/TAGOUT PROCEDURES AND SITE SAFETY REQUIREMENTS
- THIS DRAWING IS DIAGRAMMATIC AND SHOULD BE USED FOR GENERAL MATERIAL INFORMATION AND SAMPLE LOCATIONS ONLY. CONTRACTOR IS TO FIELD VERIFY ALL MATERIAL LOCATIONS AND QUANTITIES.

## ABATEMENT NOTES

- APPROXIMATELY 5,000 OF ASBESTOS-CONTAINING ROOFING DEBRIS AND CONTAMINATED BLOWN-IN INSULATION IS TO BE REMOVED FROM ATTIC SPACES THROUGHOUT. SEE SPECIFICATION 02 82 13 FOR ADDITIONAL INFORMATION
- ADDITIONAL ASBESTOS-CONTAINING FLOORING IS PRESUMED TO EXIST UNDER WALL PLATES AND CASEWORK THROUGHOUT. CONTRACTOR IS TO FULLY REMOVE ALL ASBESTOS FLOORING THROUGHOUT.
- ADDITIONAL ASBESTOS-CONTAINING PIPE INSULATION LIKELY TO EXIST ABOVE CEILINGS, WITHIN WALLS, IN TUNNELS, AND IN INTERSTITIAL SPACES THROUGHOUT. CONTRACTOR TO LOCATE AND REMOVE ALL ASBESTOS PIPE INSULATION.
- 4. APPROXIMATELY 300 MERCURY VAPOR LIGHT TUBES AND 20 PCB-CONTAINING LIGHTING BALLASTS TO BE REMOVED.
- 5. CARPETING OVERLIES ASBESTOS FLOORING IN MOST LOCATIONS.
- ADDITIONAL ASBESTOS-CONTAINING BOILER, TANK, AND PIPE INSULATION TO BE REMOVED FROM BASEMENT LEVEL SEE SPECIFICATION 02 82 13 FOR QUANTITIES.
- ADDITIONAL ISOLATED AREAS OF MERCURY VAPOR LIGHT TUBE DEBRIS TO BE REMOVED FROM LOCATIONS THROUGHOUT.

#### **KEY NOTES**

- MERCURY VAPOR LIGHT TUBE DEBRIS TO BE REMOVED.
- WET WALL WITH PRESUMED ASBESTOS-CONTAINING PIPE INSULATION TO BE REMOVED.

#### LEGEND

ASBESTOS-CONTAINING FLOOR TILE AND MASTIC TO B REMOVED
TIMO I AVERG OF AGRECTOR CONTAINING ELOOP THE

TWO-LAYERS OF ASBESTOS-CONTAINING FLOOR TILE AND MASTIC TO BE REMOVED

THREE-LAYERS OF ASBESTOS-CONTAINING FLOOR TILE AND MASTIC TO BE REMOVED

ASBESTOS-CONTAINING FLOOR TILE AND MASTIC UNDER NON-ASBESTOS SHEET FLOORING TO BE REMOVED

WAINSCOTING WITH ASBESTOS-CONTAINING MASTIC TO ++++++++ BE REMOVED

## **ASBESTOS SAMPLE SYMBOLS**

- DRAWING REFERENCE TO BULK SAMPLE FIELD CODE. ♦ 007 -SEE INVENTORY OF SAMPLES MATERIAL SYMBOL

TESTED	-	+	
0	⊖	•	THERMAL SYSTEM INSULATION
			SURFACING MATERIAL
$\Diamond$	♦	•	MISCELLANEOUS MATERIAL


# **INVENTORY OF ASBESTOS SAMPLES**


DRAWING REFERENCE	FIELD CODE	LAB RESULT	MATERIAL SAMPLED			
♦001	23514.174-0001	(-)	GLUED-ON CEILING TILES			
<b>♦</b> 002	23514.174-0002	(-)	WALL AND CEILING PLASTE			
<b>\$</b> 003	23514.174-0003	(+)	MASTIC			
<b>0</b> 04	23514.174-0004	(-/-/-)	COVEBASE/MASTIC			
♦ 005	23514.174-0005	(+)	MASTIC			
♦ 006	23514.174-0006	(+/<1%)	VINYL FLOOR TILE/MASTIC			
♦007	23514.174-0007	(-/-)	VINYL FLOOR TILE/MASTIC			

# INVENTORY OF ASBESTOS SAMPLES (CONTINUED)

1002 △ 1003 ▲

INVENTORY OF ASBESTOS SAMPLES (CONTINUED)				INVENTORY OF ASBESTOS SAMPLES (CONTINUED)			
DRAWING REFERENCE	FIELD CODE	LAB RESULT	MATERIAL SAMPLED	DRAWING REFERENCE	FIELD CODE	LAB RESULT	MATERIAL SAMPLED
♦ 008 ♦ 009 ♦ 010 ♦ 011 ♦ 012 ♦ 013 ■ 014	23514.174-0008 23514.174-0009 23514.174-0010 23514.174-0011 23514.174-0012 23514.174-0013 23514.174-0014	(-) (-) (-) (-/-/-/-) (-)	MORTAR BLOWN-IN INSULATION BLOWN-IN INSULATION BLOWN-IN INSULATION PAPER FELT MECHANICAL ISOLATION CLOTH TEXTURED CEILING MATERIAL	♦ 024 ♦ 025 ♦ 026 ♦ 027 ♦ 028 ♦ 029 ♦ 030	23514.174-0024 23514.174-0025 23514.174-0026 23514.174-0028 23514.174-0029 23514.174-0030	(-/<1%/-) (-/-/-) (+/-) (+) (<1%) (-/-) (+)	MASTIC SHEET FLOOR COVERING VINYL FLOOR TILE/MASTIC BUILT-UP ROOFING CAULK BUILTS & MORTAR CAULK
♦ 015 ♦ 016 ■ 017 ♦ 018 ♦ 019 ■ 020 ♦ 021 ■ 022 ♦ 023	23514.174-0015 23514.174-0016 23514.174-0016 23514.174-0018 23514.174-0019 23514.174-0020 23514.174-0022 23514.174-0022 23514.174-0023	(-/-) (-/-) (<1%) (-) (-/-) (-/-) (-/-/-) (-/-/-)	VINYL FLOOR TILEMASTIC CERAMIC TILE/GROUT SINK UNDERCOATING WALL AND CEILING PLASTER LAY-IN CEILING TILE SINK UNDERCOATING VINYL FLOOR TILE/MASTIC TEXTURED CEILING MATERIAL GLUED-ON CEILING TILES	♦ 031 ♦ 035 ♦ 039 ♦ 040 ♦ 041 ♦ 042 ♦ 043 ♦ 044 ♦ 045	23514.174-0031 23514.174-0035 23514.174-0035 23514.174-0040 23514.174-0041 23514.174-0042 23514.174-0043 23514.174-0044 23514.174-0044	(-) (-) (-) (-/-) (-/-/-) (-/-/-) (<1%/-) (-/-/-)	CONCRETE COATING WINDOW GLAZING COMPOUND CONCRETE ROOFING WALL AND CEILING PLASTER WALL AND CEILING PLASTER GYPSUM WALLBOADD/ JOINT COMPOUND WALL AND CEILING PLASTER WALL AND CEILING PLASTER WALL AND CEILING PLASTER WALL AND CEILING PLASTER
							,

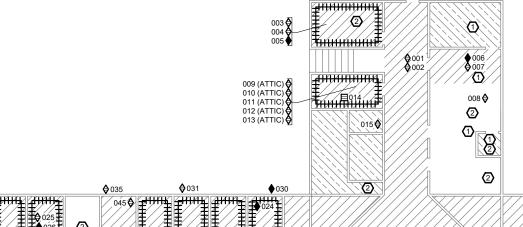

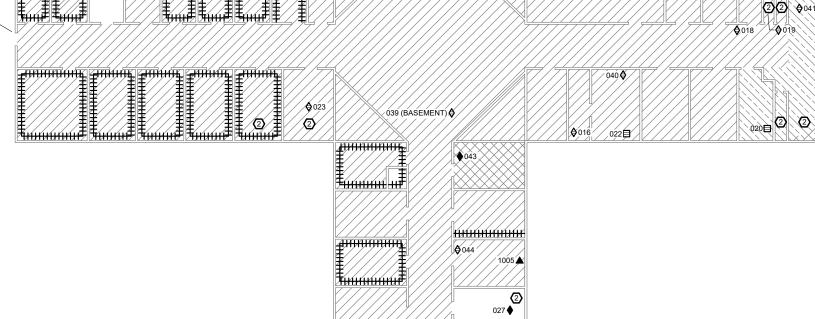

1004

<del>дидидиди</del>,

FIRST FLOOR PLAN - BUILDING "F"



**ABATEMENT** 

HAZARDOUS MATERIAL

SITE

EDGEFIELD

DRAWN BY JAB CHECKED: JMc DATE: APRIL 2021 PROJECT NUMBER 23514.174

HA1

IEET 1 OF 3

WOOD

244TH

PREPARED FOR: PORTLAND PUBLIC SCHOOLS