GENERAL NOTES

- ASBESTOS-CONTAINING MATERIALS ARE PRESENT IN ACCESSIBLE AND INACCESSIBLE INTERSTITIAL SPACES THROUGHOUT THIS BUILDING.
- MATERIALS CONTAINING <1% ASBESTOS ARE PRESENT THROUGHOUT THE BUILDING. SEE HAZARDOUS MATERIALS SURVEY AND SPECIFICATION 02 82 21 FOR ADDITIONAL INFORMATION
- ALL CONTRACTORS PERFORMING DEMOLITION ACTIVITIES ARE TO COMPLY WITH ALL APPLICABLE LEAD REGULATIONS IN OAR 437-DIVISION 3, 1926.62 AND SECTION 02 83 19 OF THE SPECIFICATIONS.
- CONTRACTOR IS TO COORDINATE ALL ABATEMENT ACTIVITIES WITH CONSTRUCTION MANAGER/GENERAL CONTRACTOR INCLUDING BUT NOT LIMITED TO: SCHEDULING, PHASING, ACCESS, AND SECURITY, POWER AND WATER NEEDS, PROTECT AND SAVE ITEMS, LOCKOUT/TAGOUT PROCEDURES AND SITE SAFETY REQUIREMENTS.
- THIS DRAWING IS DIAGRAMMATIC AND SHOULD BE USED FOR GENERAL MATERIAL INFORMATION AND SAMPLE LOCATIONS ONLY. CONTRACTOR IS TO FIELD VERIFY ALL MATERIAL LOCATIONS AND QUANTITIES.

ABATEMENT NOTES

- ADDITIONAL ASBESTOS-CONTAINING FLOORING IS PRESUMED TO EXIST UNDER WALL PLATES AND CASEWORK THROUGHOUT. CONTRACTOR IS TO FULLY REMOVE ALL ASBESTOS FLOORING THROUGHOUT.
- 2. APPROXIMATELY 20 MERCURY VAPOR LIGHT TUBES TO BE REMOVED.
- 3. CARPETING OVERLIES ASBESTOS FLOORING IN MOST LOCATIONS.

KEY NOTES

MERCURY-CONTAINING SWITCH TO BE REMOVED.

LEGEND



ASBESTOS-CONTAINING FLOOR TILE AND MASTIC TO BE REMOVED

TWO-LAYERS OF ASBESTOS-CONTAINING FLOOR TILE AND MASTIC TO BE REMOVED

TWO-LAYERS OF ASBESTOS-CONTAINING SHEET FLOORING TO BE REMOVED

ASBESTOS SAMPLE SYMBOLS

DRAWING REFERENCE TO BULK SAMPLE FIELD CODE, SEE INVENTORY OF SAMPLES

MATERIAL SYMBOL

NOT NEGATIVE POSITIVE

LOILD		
0	Θ	
^	Δ	

THERMAL SYSTEM INSULATION SURFACING MATERIAL

MISCELLANEOUS MATERIAL

INVENTORY OF ASBESTOS SAMPLES

DRAWING REFERENCE	FIELD CODE	LAB RESULT	MATERIAL SAMPLED
\$ 100	23514.174-0100	(-/-/-)	VINYL FLOOR TILE/MASTIC
Å 101	23514.174-0101	(-/-/-)	WALL AND CEILING PLASTER
Å 102	23514.174-0102		WALL AND CEILING PLASTER
Å 103	23514.174-0103		WINDOW GLAZING COMPOUND
4 104	23514.174-0104	(-/-)	GYPSUM WALLBOARD
Å 105	23514.174-0105		COVEBASE/MASTIC
106	23514.174-0106	(-/-/+)	VINYL FLOOR TILE/MASTIC
Å 107	23514.174-0107	(-/-) ´	COVEBASE/MASTIC
4 108	23514.174-0108	(-/-/-)	VINYL FLOOR TILE/MASTIC
1 09	23514.174-0109	(<1%)	MASTIC
♦ 110	23514.174-0110	(-)	MASTIC
♦ 111	23514.174-0111	(-)	MASTIC
4 112	23514.174-0112	(-)	SHEET FLOOR COVERING
♦ 113	23514.174-0113		WALL AND CEILING PLASTER
♦ 114	23514.174-0114	(-)	ASPHALT IMPREGNATED PAPER
Q 115	23514.174-0115	(-)	CERAMIC TILE GROUT
Q 116	23514.174-0116		VINYL FLOOR TILE/MASTIC
117	23514.174-0117	(-/+/+/-/-)	SHEET FLOOR COVERING
118	23514.174-0118	(-/<1%/+)	VINYL FLOOR TILE/MASTIC
119	23514.174-0119	(-/<1%/+)	VINYL FLOOR TILE/MASTIC
4 120	23514.174-0120	(-)	BLOWN-IN INSULATION
Q 121	23514.174-0121	(-)	BLOWN-IN INSULATION
Q 122	23514.174-0122		BLOWN-IN INSULATION
Q 123			GLUED-ON CEILING TILES
124			VINYL FLOOR TILE/MASTIC
125	23514.174-0125		
Å 126	23514.174-0126		WALL AND CEILING PLASTER
A 127	23514.174-0127	(-)	MORTAR
Q 128	23514.174-0128		CEMENTITIOUS ROOF SHINGLES
Q 129	23514.174-0129		CEMENTITIOUS ROOF SHINGLES
Q 130	23514.174-0130		WINDOW GLAZING COMPOUND
Q 131	23514.174-0131		ASPHALT IMPREGNATED PAPER
4 132	23514.174-0132	(-)	CAULK

LEAD SAMPLE SYMBOLS

A 1007 — DRAWING REFERENCE TO LEAD SAMPLE FIELD CODE, SEE INVENTORY OF SAMPLES


----- MATERIAL SYMBOL


▲ LEAD DETECTED


△ BELOW THE LIMIT OF DETECTION

INVENTORY OF AA LEAD SAMPLES

SAMPLE NUMBER	FIELD CODE	LAB RESULT (ppm)	MATERIAL DESCRIPTION
▲1006	23514.174-1006	20.2	PAINT ON BUILDING B; BRICK MORTAR
▲1007	23514.174-1007	46,400	PAINT ON BUILDING B; WINDON FRAME, WOOD, GRAY
▲1008	23514.174-1008	2,750	PAINT ON BUILDING B; SIDING, WOOD, BLUE

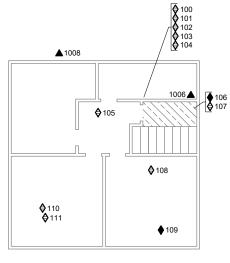

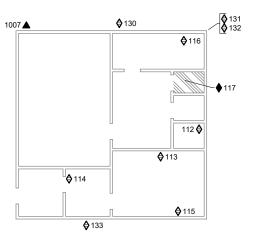

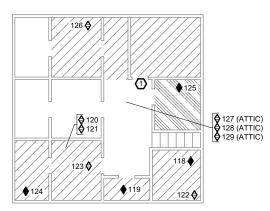

BASEMENT

FIRST FLOOR

SECOND FLOOR

BUILDING "B"



PREPARED FOR: PORTLAND PUBLIC SCHOOLS

DRAWN BY
JAB
CHECKED:
JMC
DATE:
APRIL 2021
PROJECT NUMBER:
23514.174
SHEET DRAWING NO:
HA3
SHEET 3 OF 3

\$\frac{1}{2}\$ 133 23514.174-0133 (-) CAULK

IZE SHEET FORMAT IS 24X36, IF PRINTED SIZE IS NOT 24X36, THEN THIS SHEET FORMAT HAS BEEN MODIFIED & INDICATED DRAWING SCALE IS NOT ACCURATE.

LLAGE, OREGON

HAZARDOUS MATERIAL ABATEMENT PLAN EDGEFIELD SITE 2345 NE 244TH AVENUE, WOOD VILLAGE, O